



VSP-99  
October 19, 1989

S/M

# VENDOR SERVICE PUBLICATION

TO: All Piper International Distributors, Domestic Sales Dealers, Factory Direct Dealers, Parts Distributors, and Piper Field Service Facilities

SUBJECT: Aeroquip Service Bulletin 001R1 "Recall of Aeroquip 601 Hose"

PURPOSE: To distribute the attached Aeroquip Service Bulletin No. 001R1 to all Piper Distributors, Sales Dealers, Factory Direct Dealers, Parts Distributors, and Piper Field Service Facilities.

The attached Aeroquip Service Bulletin No. 001R1 may affect hoses installed on Piper aircraft models as listed below. These hoses should be identified as per the Aeroquip Service Bulletin Instructions and removed from service if required. (For detailed location of the hoses on the applicable model aircraft refer to the appropriate Piper Parts Manual.)

All Aeroquip 601 hoses, as outlined in the Aeroquip Service Bulletin are suspect, including, but not limited to those listed below. All claims should be submitted to Aeroquip. See the attached Aeroquip Service Bulletin No. 001R1 for details.


<u>PIPER P/N</u>	<u>AIRCRAFT MODEL</u>	<u>LOCATION</u>
80026-003	PA-31T Series	Engine Fuel, Nacelle Area
80026-004	PA-31T Series	Engine Fuel, Nacelle Area
39995-026	PA-31T Series	Engine Fuel, Nacelle Area
41230-004	PA-31-350 Series	Fuel, Wing Root Area
41230-004	PA-31 Series	Fuel, Wing Root Area
565-722	PA-42	Brake, Main Landing Gear
565-722	PA-42-720	Brake, Main Landing Gear
565-722	PA-42-720R	Brake, Main Landing Gear

*We Are Flying*

## SECOND NOTICE


### GENERAL AVIATION ALERT NOTICE RECALL OF AEROQUIP 601 HOSE

Aeroquip is presently recalling certain specified 601 hose assemblies. The suspect hose assemblies consist of Aeroquip 601 hose with rubber cure dates from 1Q84 through 3Q87. This hose could have been installed on any General Aviation or experimental aircraft from April 1984 through May 1988.

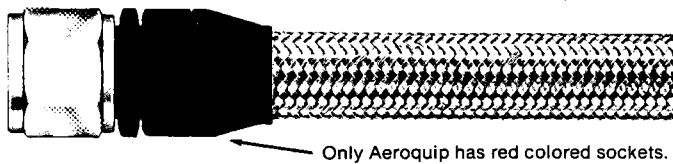

Aeroquip requests that any aircraft owners/operators who have installed hoses during the above-identified time period do the following:

- Immediately inspect the aircraft for any Aeroquip hoses. Aeroquip-produced hose assemblies are identified with a metal identification band.

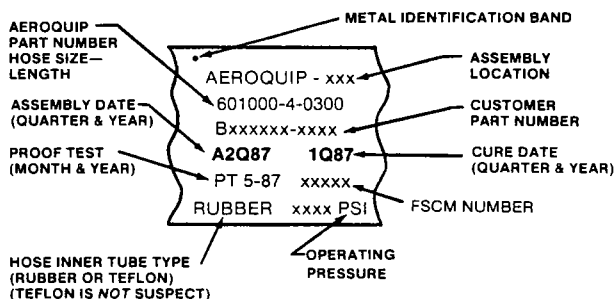

- Any Aeroquip 601 type hose assemblies that are identified with 1Q84 through 3Q87 hose cure date are suspect and should be removed. The cure dates may be shown CD1Q84 through CD3Q87.
- If the hose cure dates are not shown, then Aeroquip 601 type hose assemblies identified with an assembly date of A2Q84 through A2Q88 should be removed. If assembly date is shown in month and year, remove all assemblies with assembly date April 1984 through May 1988.
- The Aeroquip 601-3 hose is *not* suspect.

- The Aeroquip 601 type hose assemblies could be identified in the following ways:

- "AE" prefix (except AE701xxx)  
Examples: AE1010188, AE705609-1

- 601xxx or 620xxx  
Examples:

601000-x-xxxx	601126-x-xxxx	620111-x-xxxx
601001-x-xxxx	601173-x-xxxx	620112-x-xxxx
601002-x-xxxx	601180-x-xxxx	620113-x-xxxx
601003-x-xxxx	601181-x-xxxx	620115-x-xxxx
601005-x-xxxx	601378-x-xxxx	620116-x-xxxx
601017-x-xxxx	601490-x-xxxx	620117-x-xxxx
601019-x-xxxx	601497-x-xxxx	620118-x-xxxx
601032-x-xxxx	620100-x-xxxx	620119-x-xxxx
601040-x-xxxx	620102-x-xxxx	620120-x-xxxx
601051-x-xxxx	620103-x-xxxx	620121-x-xxxx
601053-x-xxxx	620104-x-xxxx	620122-x-xxxx
601054-x-xxxx	620105-x-xxxx	620123-x-xxxx
601055-x-xxxx	620106-x-xxxx	620124-x-xxxx
601056-x-xxxx	620107-x-xxxx	620125-x-xxxx
601057-x-xxxx	620108-x-xxxx	620126-x-xxxx
601065-x-xxxx	620109-x-xxxx	620144-x-xxxx
601086-x-xxxx	620110-x-xxxx	

- Aeroquip 601 type bulk hose could be identified by a white label with FSCM "50556" in red print. Labels with black print and FSCM "06827" are not suspect regardless of cure date. If there is no label or it is illegible, the hose is to be considered suspect.

- All hose assemblies identified with an AE701xxxx( )xxxx part number are *not* suspect and should *not* be removed unless, upon inspection and/or performance of routine maintenance, a problem with the hose is identified.

- If the hose assembly has no band or it is illegible and can be identified as an Aeroquip hose, the hose assembly should be removed and replaced if it was installed from April 1984 through May 1988.

- This notice *does not* apply to Gulfstream Aircraft, Bell Helicopter or McDonnell Douglas Helicopter Model 500. Separate service bulletins will be issued for operators of Gulfstream Aircraft, Bell Helicopter and McDonnell Douglas Helicopter Model 500.

When the suspect hose assemblies have been identified, contact one of the authorized Aeroquip distributors identified on the reverse side of this Alert Notice, and provide that Aeroquip distributor with the following information:

Owner's Name:  
Address:  
Phone Number:  
Aircraft Registration Number:  
Hose Assembly, Part Number or Description:

*Continued.*

The authorized Aeroquip distributor will send you replacement hose assemblies. Complete instructions informing you how to return the suspect hose assemblies to the Aeroquip distributor will be included with the replacement hose assemblies. You will be billed by the distributor for the replacement hose assemblies and subsequently credited for the full amount when the distributor receives the removed suspect hose assemblies.

For each hose assembly which you return, consistent with the procedures contained in this bulletin, Aeroquip will pay you fifteen dollars (\$15.00 U.S.) towards replacement expenses.

If there are any questions or if you are unable to contact one of the authorized Aeroquip distributors, then contact Aeroquip at 1-800-541-1696. (U.S. only - Non U.S. locations use TELEX No. 223412)

This offer for no-charge replacement hose assemblies expires December 19, 1989.

## **AEROQUIP HOSE SHOPS**

Aero Hardware & Supply, Inc.  
4301 N.W. 36th Street  
Miami Springs, FL 33166  
Phone: 305-883-8424

Airparts  
5801 West Harry  
P.O. Box 12370  
Wichita, KS 67277  
Phone: 316-943-2377

Fournier Rubber & Supply Company  
1341 Norton Avenue  
P.O. Box 265  
Columbus, OH 43216  
Phone: 614-294-6453

Herber Aircraft Service, Inc.  
124 Center Street  
El Segundo, CA 90245  
Phone: 213-322-9575

Hoses Unlimited, Inc.  
618 Doolittle Drive  
San Leandro, CA 94577  
Phone: 415-632-4477

Piedmont Aviation Supply  
3820 North Liberty Street  
Winston-Salem, NC 27102  
Phone: 919-767-5993

Superior Air Parts, Inc.  
15800 Midway Road  
Dallas, TX 75244  
Phone: 214-991-8364

Varga Enterprises, Inc.  
2350 South Airport Blvd.  
Chandler, AZ 85249  
Phone: 602-963-6936

Nelson-Dunn, Inc.  
940 South Vail Avenue  
Montebello, CA 90640  
Phone: 213-724-3705

Alamo Accessories, Inc.  
10843 Vandale  
San Antonio, TX 78216  
Phone: 512-349-9721

Omaha Airplane Supply  
Eppley Airfield  
Omaha, NE 68119  
Phone: 402-422-6666